

28

Date: Tuesday, 6/19/2007 2:10:38 PM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : SKID TUBE ASSEMBLY
 Job Number : 32972
 Estimate Number : 12520
 P.O. Number : *N/A* Part Number : D205634045
 This Issue : 6/19/2007 S.O. No. : *N/A* Drawing Number : D2580 REV C/DE09183B
 Prsht Rev. : NC Project Number : *N/A*
 First Issue : *N/A* Type : LANDING GEAR Drawing Revision : C/B
 Previous Run : 32971 Material : *N/A*
 Due Date : 7/11/2007 Qty: 1 Um: Each
 Written By :
 Checked & Approved By : *[Signature]*
 Comment : Est Rev:C Revised Steps 06-09-06 JLM

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy D205-634 bluefile & type labels per PPP D205-634-045 CHG001

KS 07-08-28

2.0 D25001190 Ext'n -1' Beam Tube 4"



Comment: Qty.: 1.0400 Each(s)/Unit Total : 1.0400 Each(s)

Pick:

Qty Part Number

Description

1 D2500-1-190

Skid Tube Extrusion

*Batch B29602**JB7-6-27*

3.0 D2596 205 Web



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

1 D2596

205 Web

Batch

B33058

4.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage

2-Cut D2500-1-190 per Dwg D2580 if necessary Deburr ends

3-Drill pilot holes using drill jig DT 8149

4-Acid etch and Alodine tube per QSI 005 4.1

5-Open holes to 0.500" as per Dwg D2580 without cutting fluid

JB7-6-26

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 6/19/2007 2:10:38 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 32972

Part Number: D205634045

Job Number:



Seq. #:

Machine Or Operation:

Description :

6-Countersink holes as per Dwg D2580 without cutting fluid

7-Deburr and blow out all chips from inside of tube

8-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 m 104739

Sikaflex expire date: 7-10-1

Start Time: 3:15 Date: 7-6-27

Fin Time: 11:00 Date: 7-6-28

5.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

6.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends after cutting. Remove alodine from around holes

2-Drill extra fwd hole as per DEO 9183 using
drill jig DT8461

3-Drill extra middle hole as per DEO 9183 using
drill jig DT8462

4-Drill extra aft holes as per DEO 9183 using
drill jig DT8463 & DT8091

7.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

8.0

D25763

Step (Machining Detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2576-3

Step

33464 BE 070723

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: D Date: 07/08/13
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action		Sign & Date	Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng				
07/11/13	4.3	WOB was installed wrong. holes were mis aligned.	<u>PS/01/12</u>	see NCR 183. Horizontally open the holes 0.020" to allow the x-bolt spacers to pass. deburr & touch-up with Hoclite. see attached email.	<u>7-7-12</u>	<u>Er</u> <u>7/07/13</u>	<u>PS/01/12</u>	<u>07/02/13</u>

NOTE: Date & initial all entries

Date: Tuesday, 6/19/2007 2:10:38 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 32972

Part Number: D205634045

Job Number:



Seq. #:

Machine Or Operation:

Description:

9.0

D2579

Crossbolt Spacer



Comment: Qty.: 24.0000 Each(s)/Unit Total: 24.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
24	D2579	Spacers	B3308 /

BE 07-07-23

10.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Prepare tube for welding D2576-3 StepRemove alodine as required.

DP 7-7-12

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R Aluminum Rod

M104907

BE 07-07-23

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004. For D2579

spacers, weld one

side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R Aluminum Rod

M104907

BE 07-07-23

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

DP 7-7-30

5-Drill holes for wearplates using DT 8217Open holes to 19/64", adjust stopper not to hit web. Deburr

DP 7-7-30 / 3' ANN

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Deburr holes

*****DO NOT COUNTERBORE EXTRA HOLES PUT IN AT STEP 13, 14 AND 15 (LEAVE AT 0.384"Ø AS PER DEO 9183)****

7-Drill pilot holes for aft cap using DT 8215 Open holes to #6 Drill bit. Deburr

DP 7-8-1

8-Drill pilot holes for Tow ring using DT8091, open to .640"and Deburr

11.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

07/08/07

12.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

07/08/08

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 6/19/2007 2:10:38 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 32972

Part Number: D205634045

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

POWDER COATING

POWDER COATING



m102316

FL



07/08/22

①

Comment: POWDER COATING

Powder Coat ****GREEN****Sandtex (Ref: 4.3.5.8) as per QSI 005 4.3

PRESS WASH BL/FX 07-08-22

14.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

EO 07-08/22 ①

15.0

D25771

Wearplate Fwd



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

1

D2577-1

Wearplate

B32649

ell

16.0

D25773

Wearplate Aft



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

1

D2577-3

Wearplate

B32097

ell

17.0

D25775

Wearplate, Centre



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

1

D2577-5

Wearplate

B330812

ell

18.0

ALS71032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

44

ALS7-1032-130

Inserts

M102475

44 07-08-23 ①

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____, PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 6/19/2007 2:10:38 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 32972

Part Number: D205634045

Job Number:



Seq. #:

Machine Or Operation:

Description :

19.0

AN960JD10L

Washer



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
44	AN960JD10L	Washer	M1104885

MS

20.0

AN34A

Bolt



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
44	AN3-4A	Bolt	M1104817

MS

21.0

D25941

Plug



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

plug

Batch: *2 batches => B32651(x5) M1

22.0

D25943

O-Ring



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

o-ring

Batch: B27168 M1

23.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: B34202 M1

24.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: M100188

MS 07-08-23

(P)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: PL Date: 09/18/13
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 6/19/2007 2:10:38 PM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 32972

Part Number: D205634045

Job Number:



Seq. #:

Machine Or Operation:

Description:

25.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

Batch: M104885

MS

M1 07-08-23

C

26.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R Sikaflex-291 M104616

Sikaflex expire date: 07-09

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 M104616

Sikaflex expire date: 07-09

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

M104942

Batch: M104942

MS 07-08-23 C

27.0

QC5

INSPECT WORK TO CURRENT STEP



Er 07/08/23



all plugs in tube

Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

28.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-045

Location:

PPP Rev:

E

7/8/29 SP

C

29.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

D 07/08/30

Job Completion



W 07/08/30

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries



DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. C SHEET 1 OF 2
DATE 98.08.26		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	

RELEASED
98/09/17 DS

QTY	Part Number	Description
X	D2580-041	SKIDTUBE ASSEMBLY
*	D2500-1	EXTRUSION
1	D2596	205 WEB
1	D2575	AFT CAP
1	D2576 - 3	STEP
20	D2579	CROSS BOLT SPACER
16	D2594-1	PLUG
16	D2594-3	O-RING
1	D2577-1	WEARSHOE
1	D2577-3	WEARSHOE
1	D2577-5	WEARSHOE
44	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or ALS4-1032-130	INSERT
46	AN3-4A	BOLT
46	AN960JD10L	WASHER

98.08.28
UP 98.08.28


EFFECTIVE DEOS
98/12/14
DEO 9124
DED 9183

GENERAL NOTES:


- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) LENGTH OF D2500-1 EXTRUSION BEFORE BENDING = 190 INCHES *
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL $\varnothing 0.297$ HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (44 PLACES) AFTER FINISH. INSTALL AN3-4A BOLTS AND AN960JD10L WASHERS WITH SIKAFLEX-241.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 32972


DETAIL A
SCALE 5:24

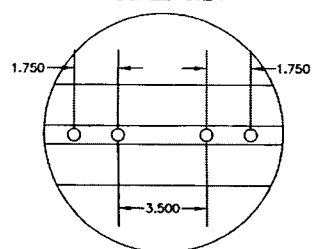


DETAIL B
SCALE 5:24

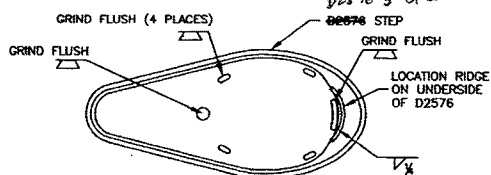

DETAIL C
SCALE 5:24

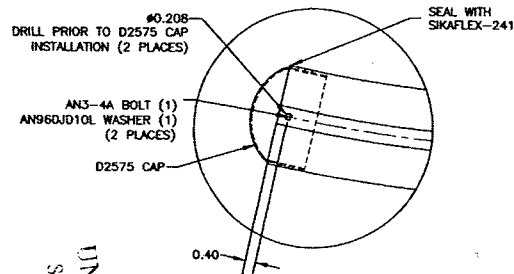


SECTION D-D
SCALE 5:24

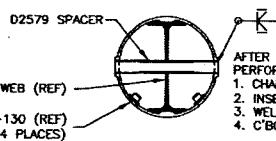


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO #0.437 X 1.00 DEEP


D2580-1 DRILLING DETAIL

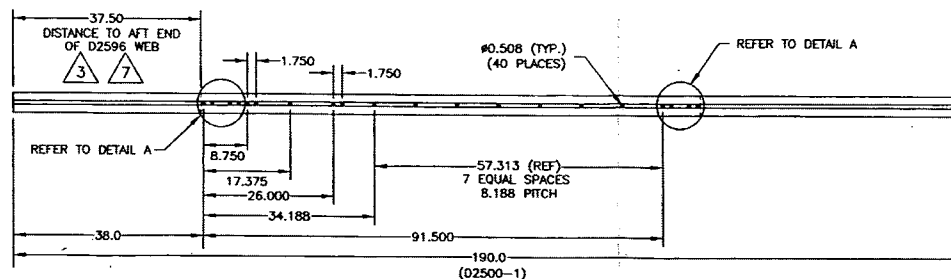

D2580-1 BENDING AND CUTTING DETAIL

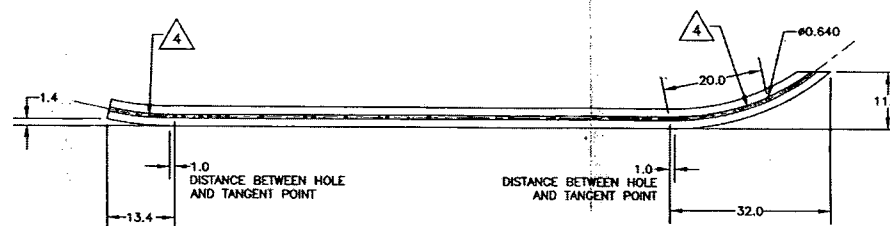

D2580-041 ASSEMBLY DETAIL

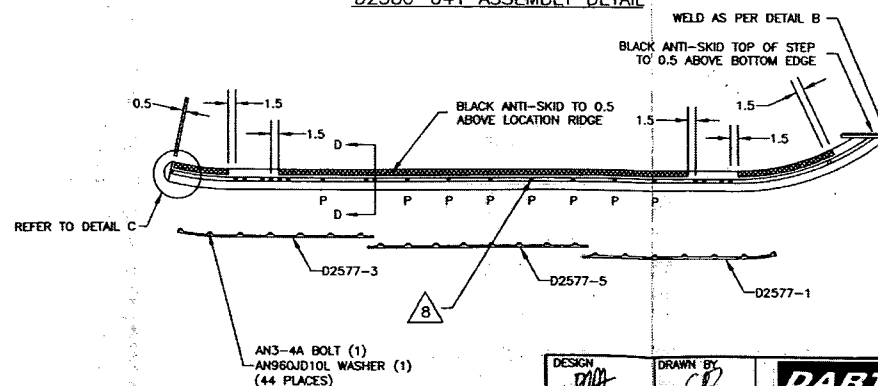


RELEASED
98/09/17 DS

DESIGN DHA	DRAWN BY CP	DART DART AEROSPACE LTD HARRISBURY, ONTARIO, CANADA	REV. C
CHECKED DHA	APPROVED CP	DRAWING NO. D2580	SHEET 2 OF 2
DATE 98.08.26		TITLE 205 SKIDTUBE ASSEMBLY	SCALE 1:24



NO. 32912
WORK ORDER
SUBJECT TO ADJUDICANT
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

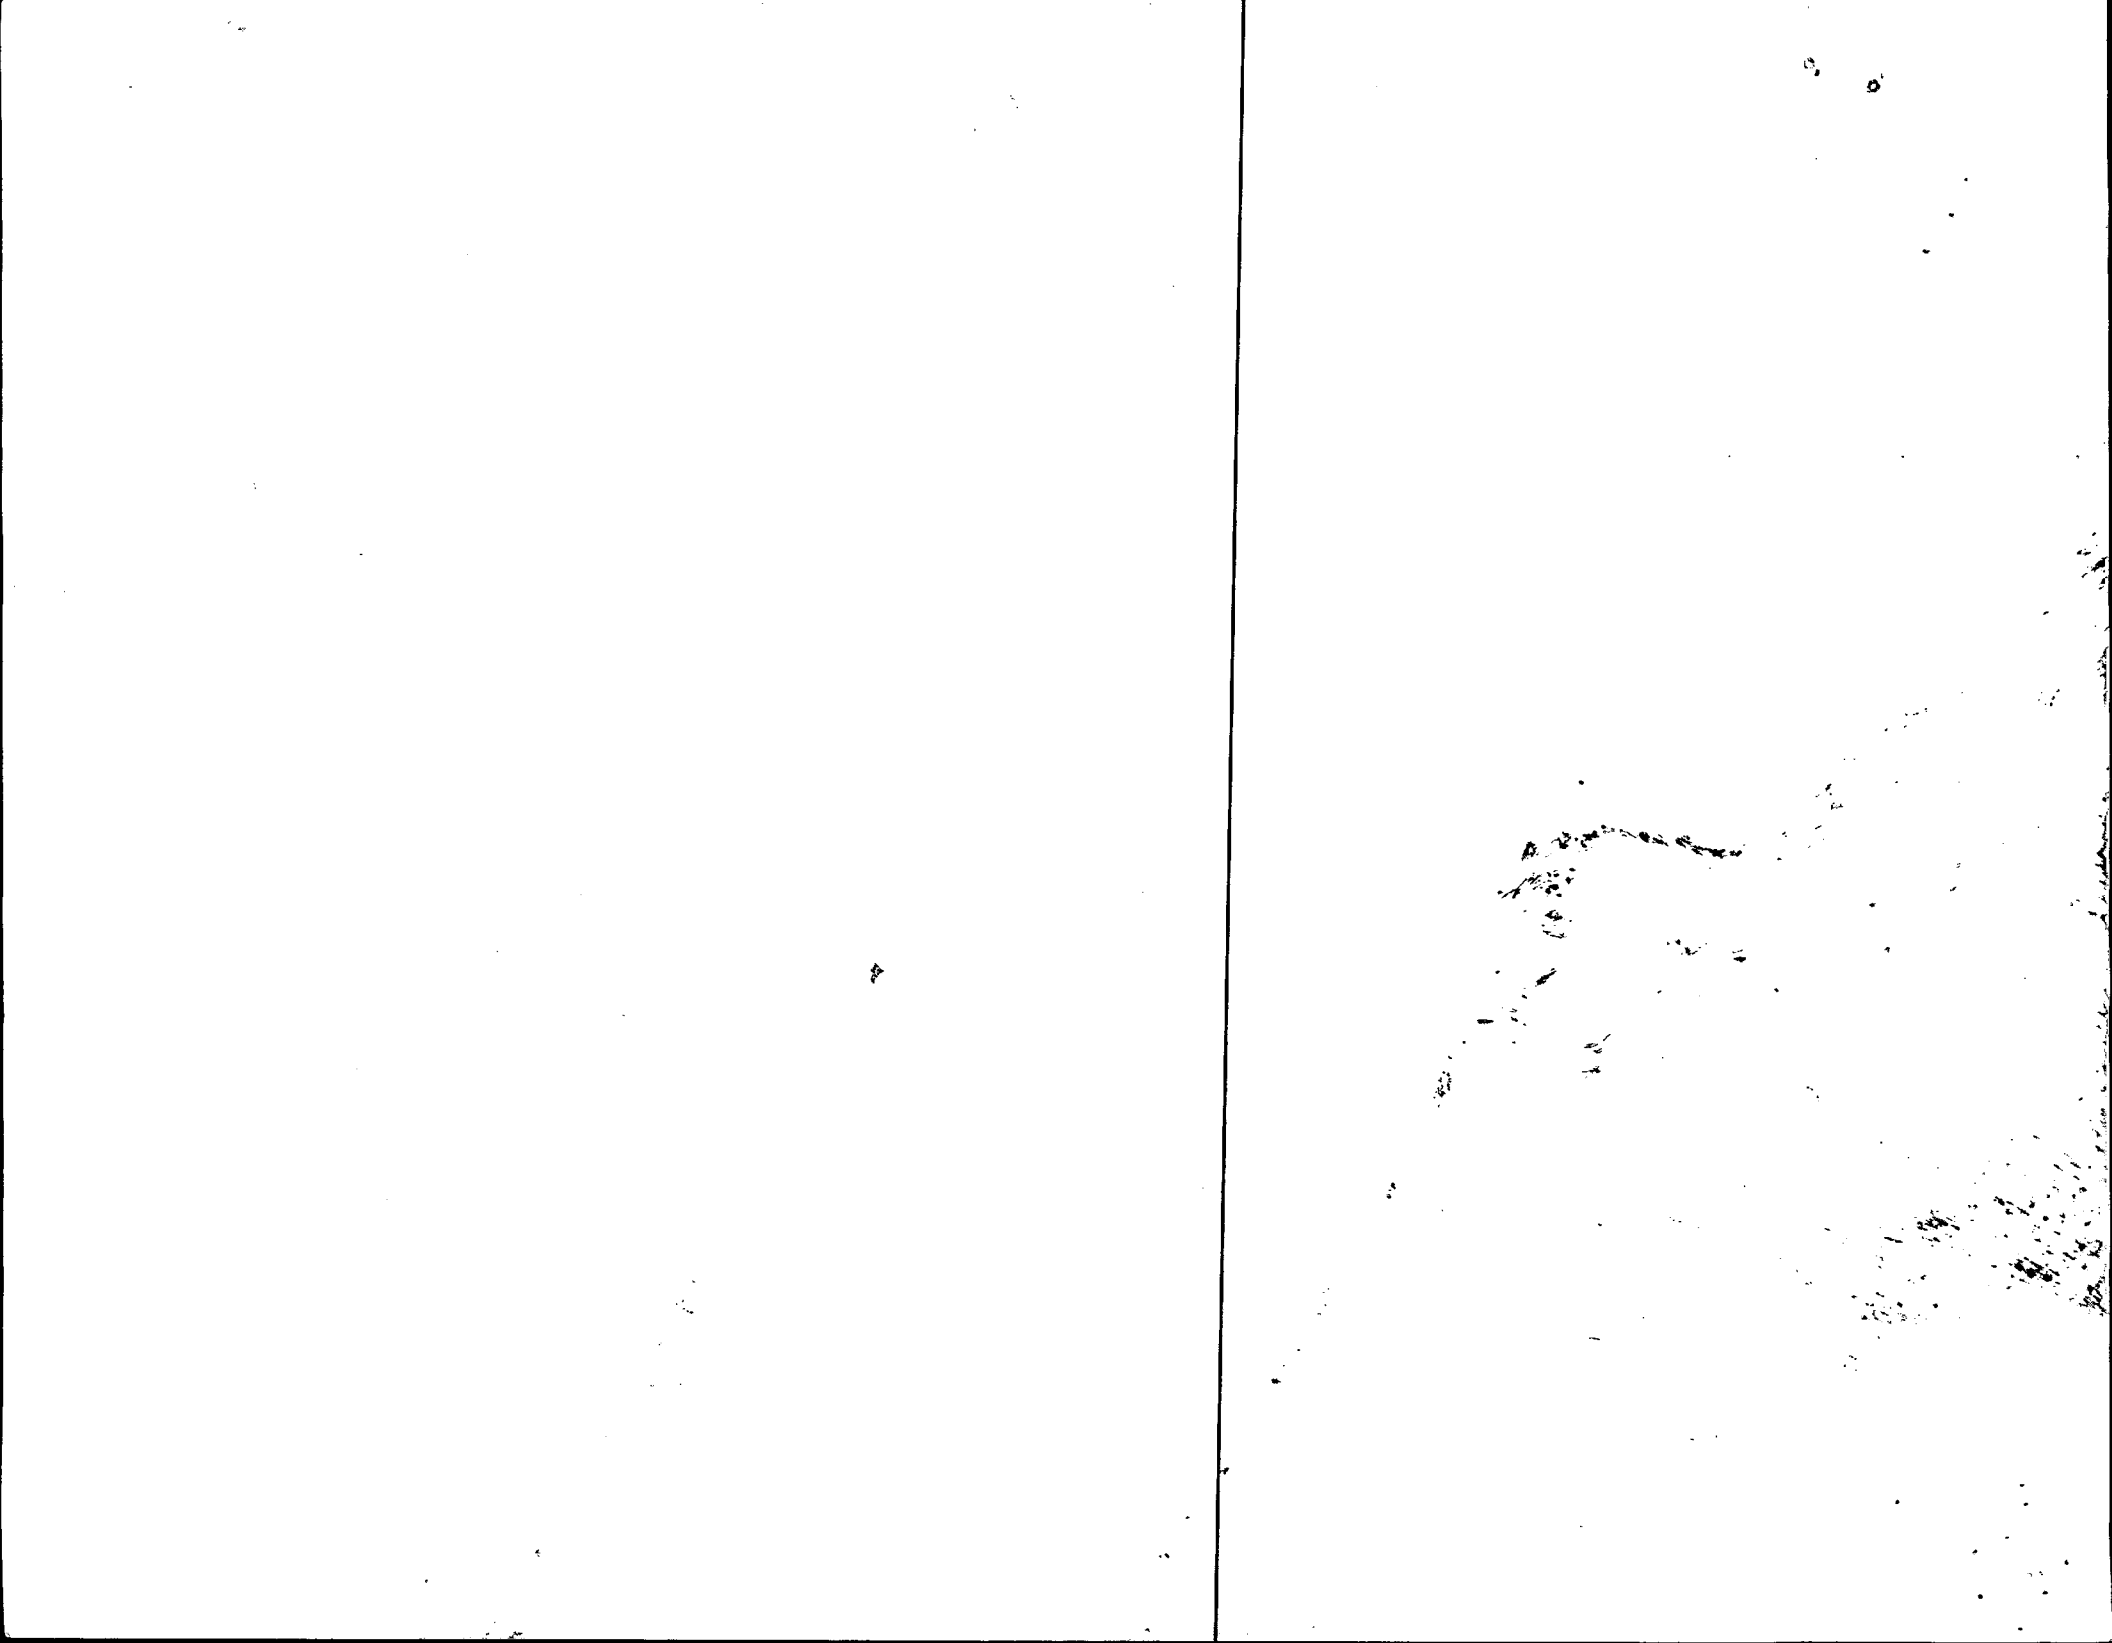

DART


DESIGN RF	DRAWN BY RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. DEO 9183	REV. B SHEET 1 OF 1
DATE 00.05.15		TITLE ADD SKIDTUBE P/N D2580-045	SCALE NTS
A	00.03.29	NEW ISSUE	
B	00.05.15	39.580 WAS 39.620	

DART ENGINEERING ORDER

AMEND DRAWING D2580 REV. C TO ADD D2580-045 ASSEMBLY

D2580-045 IS IDENTICAL TO D2580-041, EXCEPT FOR THE FOLLOWING CHANGES:

- 1) INSTALL CROSS BOLT SPACERS AT LOCATIONS MARKED 'X' ACCORDING TO THE FOLLOWING PROCEDURE.
 - a) DRILL $\varnothing 0.508$ HOLES AT LOCATIONS SHOWN BELOW MARKED 'X'.
CHAMFER HOLES $0.030 \times 45^\circ$. NOTE THAT HOLES WILL ALSO HAVE TO BE TRANSFERRED TO THE D2596 WEB AT THE * LOCATIONS. IT IS ACCEPTABLE TO PRE-DRILL THE D2596 WEB IN THESE LOCATIONS BEFORE INSTALLING THE WEB IN THE SKIDTUBE. OPEN HOLES TO $\varnothing 0.63$ AND TOUCH UP WITH ALODINE PER QSI 005 4.1.
 - b) INSERT D2579 CROSS BOLT SPACERS INTO THE HOLES.
 - c) WELD INTO PLACE PER DART QSI 004 AND GRIND FLUSH.
 - d) REMOVE SPILL OVER LEAVING HOLE DIMENSION $\varnothing 0.380$ - $\varnothing 0.390$.
- 2) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION.
- 3) POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3 INSTEAD OF WHITE (REF. 4.3.5.1).

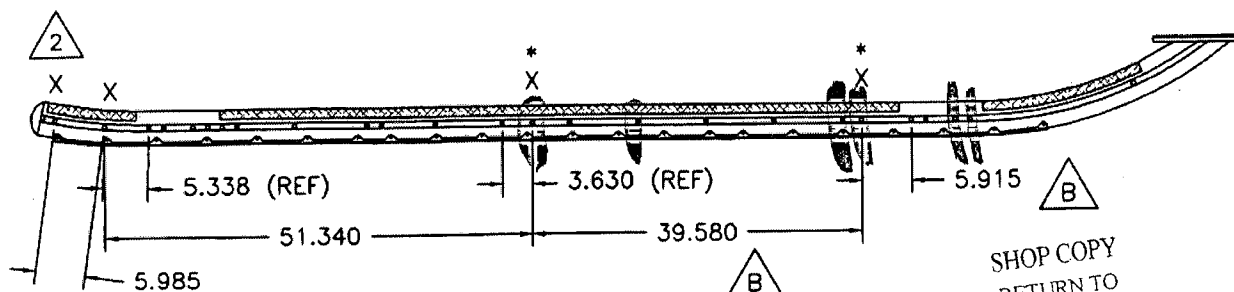

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 32972

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.



DESIGN RF	DRAWN BY RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED [Signature]	APPROVED [Signature]	DRAWING NO. DSI 9184	REV. A SHEET 1 OF 1
DATE 00.03.29		TITLE ADD SKIDTUBE P/N D205-634-015	SCALE NTS
A	00.03.29	NEW ISSUE	

DART SERVICE INSTRUCTION

TO AMEND INSTALLATION INSTRUCTIONS D205-634 REV. B.

REF. CANADIAN STA: SH96-88
US FAA STC: SR00563NY

ADD D205-634-015 INSTALLATION. PARTS LIST IS IDENTICAL
TO PARTS LIST FOR D205-634-011 EXCEPT THAT:
D205-634-045 REPLACES D205-634-041
D2580-045 REPLACES D2580-041

THE DIFFERENCE BETWEEN D205-634-011 (D205-634-041)
AND D205-634-015 (D205-634-045) IS THAT EXTRA
SPACERS HAVE BEEN ADDED AT LOCATIONS MARKED 'X' AND
ASSEMBLY IS PAINTED GREEN.



D205-634-015 (D205-634-045)

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 32972

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Jason Murdoch

From: David Shepherd [dshepherd@dartaero.com]
Sent: Tuesday, July 17, 2007 5:19 PM
To: 'L Lacelle'
Cc: 'Jason Murdoch'
Subject: RE: NCR for D205-634-045

It is acceptable to ovalize the holes in the WEB HORIZONTALLY BY 0.020" so that the crossbolt spacers can pass through the skidtube.

David

From: L Lacelle [mailto:llacelle@dartaero.com]
Sent: Tuesday, July 17, 2007 8:24 AM
To: 'Jason Murdoch'; 'David Shepherd'
Subject: RE: NCR for D205-634-045
Importance: High

David,
These are ready to ship today, we would require an ok today.
Thx
Linda

From: Jason Murdoch [mailto:jmurdoch@dartaero.com]
Sent: July 6, 2007 7:42 AM
To: 'David Shepherd'
Cc: 'L Lacelle'
Subject: NCR for D205-634-045
Importance: High

Good day David. I have 4 skids that the webs were installed too far back resulting in an interference with the x-bolt spacers and the web. Especially, where the extra holes are. I would like to ovalize the hole vertically by 0.020". These webs were installed during the famous Dart black out last week, in the dark.

jmurdoch@dartaero.com
Q.C. COORDINATOR

No virus found in this incoming message.
Checked by AVG Free Edition.
Version: 7.5.476 / Virus Database: 269.10.8/904 - Release Date: 7/16/2007 5:42 PM

No virus found in this outgoing message.
Checked by AVG Free Edition.
Version: 7.5.476 / Virus Database: 269.10.8/904 - Release Date: 7/16/2007 5:42 PM

NO. 116

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Berclay Elliott
Joint Welding Procedure Tig
Part number and Job number A205634041/B32617A

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS Tig
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical Down <input type="checkbox"/> Up <input type="checkbox"/>			
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>	
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>	
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>	
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>	

Crossbolt Spacer Welded into Skid tube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07/07/16 Qualifier David A. Newell